

Code of Practice for Commissioning

No. COP-03

Ver. 1.0

Date: 20 December 2016



Revision	Description	Released by	Date
0.1	First draft	J de Villiers	16/08/2016
1	First release	J de Villiers – Principal Engineer, Standards	20/12/2016

Reviewers:

Axel Dumont – Principal Commissioning Engineer, Watercare Clemence Carlinet – Process Engineer, Watercare Luke Mainwaring – Senior Commissioning Engineer, Watercare Simon Porter – Networks Manager Central, Watercare Geof Stewart – Manager Asset Strategy, Watercare



Table of contents

ΑI	BBREVIA	.TIONS	5
1.	INTR	ODUCTION	6
2.	COM	IMISSIONING FRAMEWORK	6
3.	COM	IMISSIONING PLAN	7
	3.1	GENERAL	7
	3.2	COMMISSIONING PRE-REQUISITES	7
4.	RISK	MANAGEMENT	7
	4.1	RISK ASSESSMENT	8
	4.2	CHANGE TO SYSTEM RISK PROFILE (CSRP)	8
5.	ROLE	ES AND RESPONSIBILITIES	8
	5.1	WATERCARE AND COMMISSIONING TEAM RESPONSIBILITIES	8
	5.1.1	Watercare project delivery lead	8
	5.1.2	Watercare Service Delivery area manager	8
	5.1.3	Watercare commissioning engineer	8
	5.1.4	Watercare site engineer	9
	5.1.5	Watercare operations controller	9
	5.1.6	Watercare site Service Delivery team	9
	5.1.7	Watercare discipline leads	10
	5.1.8	S Software team	10
	5.1.9	Contractor	10
	5.1.1	.0 Consultants	11
	5.1.1	1 Specialist suppliers	11
6.	INSP	ECTIONS AND AUDITS	11
7.	FACT	ORY ACCEPTANCE TESTING	11
8.	SITE	INSTALLATION	12
9.	SITE	ACCEPTANCE TESTING	12
	9.1	VISUAL CHECK GUIDELINES	12
	9.2	COLD TESTING	14
	9.3	HOT TESTING	14
	9.4	TRAINING	15
10). ST	TART-UP	15
	10.1	SITE INTEGRATION TESTING	15



11.	HOLD POINTS	15
12.	AUDIT AND REPORTING	15
13.	DECOMMISSIONING OF EQUIPMENT	17
1/	TEMPI ATES	17



Abbreviations

CAR Change Authority Request for control systems

CSRP Change to system risk profile

DCS Distributed control system

ERMA Enterprise risk management academy

FAT Field acceptance testing

FD Functional description

IP Ingress protection

I/O Input/output

MCC Motor control centre

P&ID Piping and instrumentation diagram

SAT Site acceptance testing

SIT Site integration testing

QA Quality assurance

QC Quality control



1. Introduction

This code of practice provides guidance and the tools for commissioning of electrical, process and mechanical plant. Commissioning is the process of bringing equipment and systems into operation. Whilst testing and certification is required through the construction and installation process, this is not adequate to demonstrate that the infrastructure will operate as intended. The commissioning process validates the operation against design parameters and is used to complete the configuration before it is handed over to Watercare for operation.


The code highlights the processes and staging of activities, roles and responsibilities. A number of templates are included in Section 14 with minimum fields for completion during commissioning. These templates can be added to as required for a specific project.

None of the tools are intended to replace quality assurance processes or any other requirements that are required from other Watercare standards, or the project specific requirements.

This guide is to highlight key considerations and provide a consistent approach to produce commissioning plans.

2. Commissioning framework

The following framework demonstrates the high level stages of commissioning. The stages can be expanded on in a specific commissioning plan to suit the project requirements.

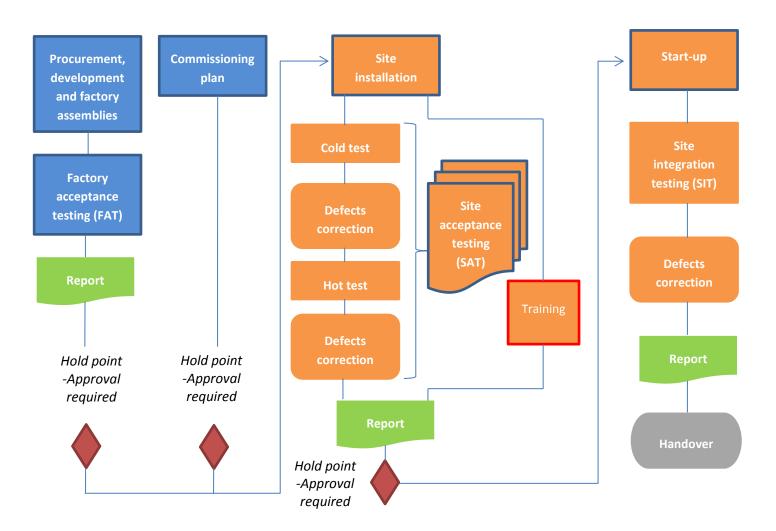



3. Commissioning plan

3.1 General

The commissioning plan is the covering strategy document that describes actions, roles and responsibilities, the commissioning programme and risk mitigation measures.

The commissioning plan is a live document that requires updating as the site conditions evolve during the installation. These changes may affect the commissioning procedures.

The content of this document should include:

- Commissioning scope
- Confirmation of standard testing requirements from Watercare construction standards
- Commissioning objectives and performance requirements set by the designer and/or contract
- Operational protocols and procedures
- Integration procedures to integrate new system with the existing system to minimise impact
- Risk assessment and mitigation strategies
- Site health and safety requirements such as exit plans, environmental controls and emergency contact
- Identify specific skill requirements, resources or temporary plant
- Provide logical sequencing of work that considers interfaces and constraints
- Effects on adjoining processes
- Identify the level of testing at the various stages of commissioning

3.2 Commissioning pre-requisites

The prerequisites that are required before the specific plant commissioning can take place may include, but are not limited to:

- Construction QA and QC certificates
- Load test certificates
- Calibration certificates
- Building certificate of compliance
- Producer statements
- ERMA certificate
- Vessel certificates
- Electrical Declaration of Conformity
- MCC, switchboard and DCS cabinet FAT test and inspection report
- Any equipment off site test reports and certificates
- Manufacturers factory test certificates and / or third party witness test certificates for components
- Maintenance schedules
- Resource consents in place

4. Risk management

Risk shall be reviewed on a suitable frequency and the register updated accordingly.



4.1 Risk assessment

Risk assessment shall be completed before commissioning work starts. The risk assessment needs to document commissioning risks and mitigation measures based on the commissioning plan and the proposed work methodologies. Any changes to the risk assessment or methodologies must be updated.

4.2 Change to System Risk Profile (CSRP)

Work affecting any existing plant, process or piping systems must be identified and a CSRP completed. The CSRP must be approved by Watercare before the work is started.

5. Roles and responsibilities

The roles and responsibilities of persons forming the commissioning team needs to be detailed at an individual level for each commissioning stage.

Each task shall have an owner, a description of the task with a step-by-step schedule, the desired outcome or measurement and the schedule by which the task must start and end.

Persons selected for a task shall be suitably qualified and experienced to complete the task.

5.1 Watercare and commissioning team responsibilities

The following sections list possible team members. The members of the team may be included as necessary for the complexity of the commissioning work. This assessment must be made with Watercare based on:

- Contractor team experience
- Consultant team experience
- Risk to existing Watercare infrastructure

5.1.1 Watercare project delivery lead

The Watercare project delivery lead has overall responsibility for the delivery of the project and liaises with the Service Delivery area manager on progress of the project and the Watercare commissioning engineer on implementation of the commissioning plan.

5.1.2 Watercare Service Delivery area manager

The Watercare service delivery area manager has overall responsibility for the plant and provides approval for the work to proceed and final acceptance once commissioning is complete.

5.1.3 Watercare commissioning engineer

The Watercare commissioning engineer leads the Watercare commissioning team. The commissioning engineer is responsible for the commissioning process and provides an interface between the contractor, consultant, discipline leads and Watercare Service Delivery. The commissioning engineer has the following responsibilities:

- Review and approval of the commissioning plan
- Liaison with the contractor, suppliers, the discipline leads and the Watercare Service Delivery staff
- Review of commissioning methodologies
- Sign off of inspected items and associated forms
- Run risk assessments on the contractor's commissioning plan and the commissioning methodologies with relevant personnel



- Arrange for review of any operational work plans associated with the commissioning activities by the operations controller
- Coordination and direction of discipline leads for witness testing and document reviews
- Coordination with software lead
- Participation in control system FAT
- Witness control system SAT
- Ensure up to date red-line mark-up documentation is available to Service Delivery staff throughout works
- Review training and training manuals in advance of a new or upgrade system coming into operation
- Assist with the implementation of isolations
- On call support for the newly operational plant and equipment
- Approval of process commissioning report.

5.1.4 Watercare site engineer

The Watercare site engineer works with the Watercare commissioning engineer throughout the commissioning process to ensure that construction related activities are prioritised to facilitate commissioning. The site engineer will also provide an additional interface between the contractor and Watercare Service Delivery with the following responsibilities:

- Liaison with the contractor, suppliers, the discipline leads and the Watercare Service Delivery staff
- Prioritisation of snag lists and ensuring priority items are completed
- Review of commissioning methodologies
- Sign off of inspected items and associated forms
- Participation in risk assessments
- Assist with the implementation of isolations
- Development of the defects list during commissioning
- Review the training documentation
- On call support for the newly operational plant and equipment
- Assist Watercare commissioning engineer.

5.1.5 Watercare operations controller

The Watercare operations controller liaises with the Watercare commissioning engineer to ensure operation of existing systems are not compromised by the commissioning activities. The operations controller is also responsible for carrying out isolations, or in the case of electrical works making sure that isolations are understood and applied in a timely manner. The responsibilities of the operations controller include:

- Participation in control system FAT
- Review of commissioning methodologies
- Review of operational work plans
- Participation in risk assessments
- Development of shutdown plans
- Implementation of isolations.

5.1.6 Watercare site Service Delivery team

The site Service Delivery team shall be informed during all stages of commissioning. The site service delivery team will be involved in a number of commissioning related activities that includes:

- Review and implementation of operational work plans to support commissioning activities
- Input into commissioning methodologies



- Participation in commissioning activity risk assessments
- Support and implementation of isolations required for commissioning

5.1.7 Watercare discipline leads

The discipline leads i.e. electrical and control, works in support of the Watercare commissioning engineer to ensure the work plans are completed and the inspection and test plan is completed. The responsibilities of the discipline leads include:

- Review of contractor work plans including inspection and test plans and check-sheets
- Participation in risk assessments for work plan and commissioning activities
- Inspection of the works prior to testing and compilation of snag lists
- Witnessing appropriate parts of the contractors testing and accepting the successful result on Watercare's behalf
- Recommending sign-off of areas to proceed to hot commissioning to the Watercare commissioning engineer.

5.1.8 Software team

The software team is responsible for the production of:

- Level 2 FD,
- Developing the software,
- Software FAT and associated documentation
- CAR form
- Software SAT
- Software commissioning documentation
- As-built of the level 1 FD.

5.1.9 Contractor

The contractor is responsible for preparing the work plans covering the inspection, testing and commissioning of all the civil, mechanical and electrical work but excluding software FAT and software SAT and software commissioning activities.

Loop testing and I/O commissioning is the responsibility of the contractor but requires interface with the software team. A protocol for these tests needs to be agreed between the contractor and Watercare with regards to timing, responsibilities and scope of this testing. The steps involved are listed below:

- Mechanical/electrical installation complete as far as possible, valves, cells exercised locally etc.
- Point to point testing completed and I/O terminated at DCS card
- Span of instruments setup, calibrated etc. where possible (i.e. with local display)
- Commissioning documentation completed as far as possible (E.g. schedules red-line mark ups)
- I/O enabled at the card by the Software Team
- Blocks of equipment shall be ready to be tested as a set
- Discrete loops all components of the loop are exercised and checked (hardware/wiring/DCS) by operating equipment from the DCS where it is safe to do so (in conjunction with Watercare)
- Analogue loops Injection testing to be performed, span match at instrument and DCS level confirmed
- Loop is checked and if functional signed off
- For issues that cannot be resolved quickly on the spot, the I/O shall be disabled and troubleshooting shall take place separately either in the DCS or in the field



- If it is a quick change i.e. adjusting a proximity switch or adjusting a software reference this will be done at the same time to complete the overall loop check
- Submit completed work plan and pre commissioning documentation

5.1.10 Consultants

The consultant commissioning representative reports to the Watercare commissioning engineer and Watercare site engineer. The consultant must ensure that commissioning, work plans, inspections and test plans are completed to meet the design performance requirements. The responsibilities of the consultant commissioning representative include:

- Review of contractor work plans including inspection and test plans and check sheets
- Inspection of the works prior and during testing
- Review commissioning methodologies and confirm performance testing plan for use in the commissioning report
- Provide technical support during all commissioning stages
- Collect documentation and data from all parties for the development of the commissioning report
- · Complete the commissioning report

5.1.11 Specialist suppliers

Specialist product suppliers must be identified and are responsible for supervising the installation, orientation, testing and commissioning of their equipment. The supplier representative will liaise with the Watercare commissioning engineer on all commissioning matters.

The supplier must provide training for personnel as part of the commissioning process.

6. Inspections and audits

Inspection and audits should comprise of the following check items for commissioning:

- Confirmation of correct make, model, etc. of the equipment specified
- Confirmation installation location and detail requirements as per the design
- Ensure safe operability
- Performance outcome as desired and correct functionality

Watercare's general construction standard lists a number of minimum quality control checks and tests during construction. These quality checks must be completed prior to commissioning.

7. Factory acceptance testing

Factory acceptance testing (FAT) is typically required where the automation or process software is complex or has redundancy measures build into the logic.

Test cases shall be based on the design functional description. The FAT checks as far as possible that:

- Equipment and components are in accordance with the specification
- Input and output connections are in accordance with the drawings
- Equipment is calibrated
- Trip points, alarms and diagnostic outputs are responsive
- Behaviour and actions are as expected from input and outputs



Operator functions, bypass and manual overrides operate as required

Any changes or modifications shall be subject to safety analysis and impact assessment. Re-testing of the equipment or programmed behaviour needs to be completed for the impacted functionalities.

The test results are reported to identify which objectives had been met or not. Any discovered problems during the test shall be recorded and the actions taken to correct the failures documented.

8. Site installation

The equipment is installed on site in accordance with the general and specific requirements prior to commissioning. The quality assurance programme is followed with the necessary quality control points signed-off.

9. Site acceptance testing

The entire new installation is tested on site to demonstrate that the logical integrity and physical reactions complies with the design requirements. Site acceptance testing may include both cold testing and hot testing, but should at a minimum be conducted as a hot test. Any deficiencies are resolved and retested.

Training for the operators on the actual equipment shall be provided during the site acceptance phase in preparation for the site integration testing and operation handover.

Site acceptance testing should include completion of:

- Finishing visual checks
- Input and output signals tested
- Equipment calibration verified
- Trip points and alarms set
- Behaviour and actions verified
- Operator functions, bypass and manual overrides verified

9.1 Visual check guidelines

The following checks serves as guidelines only, but may be used to populate the installation specific visual checks. Also refer to the Watercare civil and mechanical construction standards for the minimum quality assurance and control check sheets.

Pipework, valves and piping instruments			
Installation complete and undamaged			
Installation conform to the piping and instrumentation diagram			
Correct material type used			
Pressure rating as required on all components			
Correct diameter			
All joints fitted with gaskets/O-rings/seals			
All joints must be tight with all bolts fitted			
All the required supports are in place and the appropriate restraints applied			



Pipework, valves and piping instruments			
Confirmation of any expansion joints fitted correctly and in the designated location			
Couplings are restrained as required			
Confirm correct orientation of components			
All components are clearly identified and labelled			
Coatings finished to specification			
Paperwork in order i.e. certificates of conformity, FAT, etc.			

Mechanical equipment	
Equipment is complete and to specification	
Confirm equipment appears undamaged	
All transit packaging is removed	
Baseplates and fixings are secure	
Fastenings are correct and tight	
Restraints are in place	
All gaskets/O-rings/seals are in place	
Confirm correct orientation of components and direction of movement	
Moving parts are free to operate	
Alignment complete	
Vents and valves clear for operation	
Any oil reservoirs are to the correct level	
Mechanical interlocks free to operate and in place	
Guards are in place and secure	
Any special tools (where required) are available	
All components are clearly identified and labelled	
Coatings finished to specification	
Paperwork in order i.e. certificates of conformity, FAT, etc.	

Instrumentation	
Model make and features are to specification – suitable for are operation i.e. Hazardous areas	
All transit packaging is removed	
Confirm installation is correct to the piping and instrumentation diagram; location is as specified	
Confirm instruments appears undamaged	
Fastenings are correct and tight	
Accessible to view, maintain and replaceable	
All gaskets/O-rings/seals are in place with correct IP rating	



Instrumentation	
Confirm correct state, orientation of components and direction	
Instrument clear to operate i.e. ultrasonic view or free motion of level switch, etc.	
All components are clearly identified and labelled	
Coatings finished to specification	
Paperwork in order i.e. certificates of conformity, FAT, etc.	

Electrical		
Cable trays and cables are secure		
Complete random cable isolation tests		
Earthing installed as specified		
Cable glands are installed on all cables		
Cables are identified and labelled		
Conduits are secure and cable entries sealed		
Bending radius not exceeded		
Suitable separation between electrical and control cabling		
Control boxes and distribution boards are secure and correctly fixed		
Control boxes and distribution board enclosures are undamaged		
Enclosures are condensation free		
IP ratings are as specified		
Terminals checked for tightness		
Shrouds barriers and blanks fitted		
Installation is neat and tidy		
Enclosures, switches lights, etc. are labelled		
Switchgear oil level checked		
Mechanical operation of all switches , lockouts, position locks etc. operate freely		
Paperwork in order i.e. certificates of conformity, FAT, ESC, etc.		

9.2 Cold testing

The cold test is conducted with the installation complete but without fluid or media. This test may limit some applications where instrumentation or plant cannot be run dry.

9.3 Hot testing

The hot test is conducted with the installation complete but not connected or interacting with existing processes and often with a safe substitute fluid replacement such as air or water. Where an installation may be expected to receive or provide signal outputs these are to be verified off-line.



9.4 Training

Training shall be conducted in a planned manner identifying specific operator tasks and fault finding procedures. A training register shall be used to confirm that the persons responsible for operating the plant has been assessed as competent for safe operation once the system is handed over to Watercare.

Documentation required for training will include the necessary operating manuals of the equipment and standard operating procedures. It is expected that these may require updating as the installation is fine-tuned during the testing procedures.

10. Start-up

The system is placed into full operation and taken over for owner operation

10.1 Site integration testing

The site integration testing occurs over an agreed timeframe. During this timeframe the installation is monitored against the expected performance and to ensure that the process integrity is sustainable. Typical checks and actions include:

- Validate interaction of test points with exiting systems that could not be physically connected during site acceptance testing
- Monitoring performance as environmental conditions change
- Evaluate responses as operational conditions fluctuate
- Monitor trends and data feedback integrity
- Monitor operational interaction
- Close out problems and defects

11. Hold points

Hold points are the critical sign-off points required from Watercare before the commissioning process can continue onto the next phase.

The minimum hold points should include:

- Acceptance of the commissioning plan
- Factory acceptance testing of all componentry and software prior to site installation
- Before integrating into any existing live systems and on completion of the site acceptance testing


12. Audit and reporting

Reporting shall identify the tests that have been performed, a summary of the reaction and any actions taken to correct incorrect outcomes. Each correction shall confirm if the defect has been successfully resolved. The typical reports during the commissioning phases are:

- On completion of the FAT to document the successful completion of the testing
- On completion of the SAT to document the successful completion of the testing
- On completion of the SIT to document the completion of the commissioning work

The audit path is illustrated below:



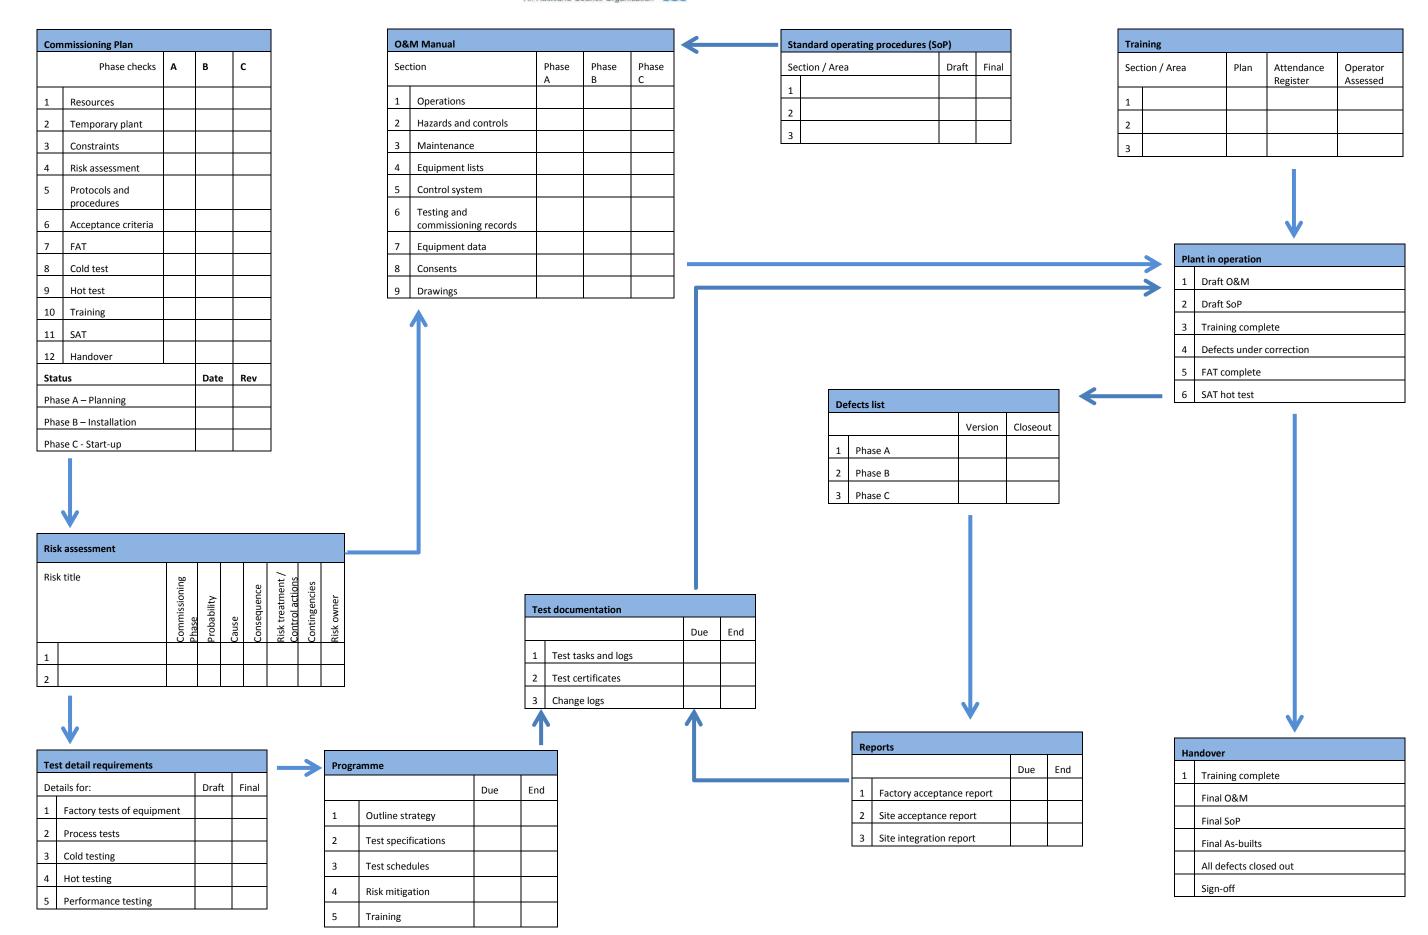



13. Decommissioning of equipment

Decommissioning of redundant equipment will generally be undertaken at the end of the project except where the space is required for the newly upgraded plant.

The items to be decommissioned need to be identified prior to starting any work. The process for decommissioning shall be as follows:

- Identify and clearly mark equipment to be decommissioned in the field
- Isolate equipment mechanically and process-wise in the field
- Up-date I/O schedules to show the signals to be removed
- Decommission the I/O one at a time
- When all I/O are removed, isolate equipment electrically in the field
- Remove redundant software and confirm there are no unresolved references
- Physical removal of the equipment and ensure the site is safe

14. Templates

The following templates is can be used or modified and expanded to suit the installation requirements:

<u>Tei</u>	mplate		No.
•	Commi	ssioning plan	
•	Test pla		
•	Test sch		S-01
•	Test sp	ecification	
•	•	ssioning log	
•	Defects		
•	Training	g register	
•	Control	system end of day checklist	S-02
•	Test ce	rtificates - configuration:	
	0	Pipework	C-01
	0	Valves, penstocks and actuators	C-02
	0	General electrical	C-03
	0	Calibration – flow/speed/mass	C-04
	0	Level	C-05
	0	Instrument installation	C-06
	0	Instrument setup	C-07
	0	Instrument loop calibration	C-08
	0	PLC I/O tests	C-09
	0	PLC Analogue test	C-10
	0	Variable speed drives	C-11
•	Test ce	rtificates - functionality:	
	0	Leakage test	F-01
	0	Valves, penstocks and actuators	F-02
	0	Pumps and blowers	F-03
	0	Chemical dosing control	F-04
	0	Process control set values	F-05
	0	PLC variables	F-06



o SCADA Analogue test F-07

Interface test F-08



Commissioning Plan (Template)

1. Introduction

[Description of the project]

2. Commissioning objectives

[Describe the commissioning philosophy, purpose and output requirements. Include any decommissioning requirements and identify how the staging and interaction will happen]

3. Commissioning scope/Systems to be commissioned

[List of systems to be commissioned and the inter system connectivity]

4. Commissioning team

[Tabulate team members, their roles, title and contact details]

Role	Company	Name	Title	Contact number		Email address
				Working hours	After hours	
[Project delivery lead, etc.]	[Watercare, etc.]	[Joe Blogs]	[Project manager, etc.]	[0211234567]	[1234567]	[j.blogs@email.nz]

4.1 Roles and responsibilities

[Describe the responsibilities of the roles listed. See section 5.1 for typical expectation]

4.2 Special resources

[Create a list/table of other additional resources that may be required]

Resource description	Used for	Commissioning activity	Responsibility	Schedule number
[exmpl. 12 tonne crane]	[exmpl. Lifting chamber cover]	[exmpl. Valve actuators in inlet structure]	[exmpl. Contractor X]	[exmpl. #8]

4.3 Communications plan

[Identify daily communications such as end-of day handover or shift-change procedures, meeting frequency, notification processes and the like]

5. Health and Safety and Environmental planning

[Identify site specific management of activities that impact on the environment, such as flushing of chlorinated lines. Identify the specific PPE requirements, procedures such as confined spaces entry and actions such emergencies or measures of handling]



6. Activity plan

6.1 Isolation plan

[Identify isolations that are required and the process to be followed to allow the isolations to be made]

6.2 Factory acceptance testing

[Identify factory acceptance tests that must be complete before cold and hot testing may commence]

6.3 Cold testing

[Activities: what, why, when and how]

6.4 Hot testing

[Activities: what, why, when and how]

6.5 Commissioning schedule

[Schedule produced in MS project]

7. Quality management

[Description of how the quality of the commissioning work will be managed on site]

8. Watercare site specific requirements

8.1 General

[Describe the site conditions, access requirements and processes that may be relevant]

8.2 Existing plant/processes

[Ongoing operations that may be impacted on by the commissioning (must also be considered as part of the risk management process)]

9. Risk management

9.1 Risk register

[Tabulated risks register with risk score, resolution and responsibilities]

9.2 Time for corrections and escalation process

[Identify the agreed period for correcting snags or defects during commissioning and how this will be accommodated in the commissioning schedule. Describe the escalation process to be followed when snags are not resolved on time]

10. Commissioning documentation

Appendix A – Schedules and logs



Appendix B – Configuration tests Appendix C – Functionality tests



Proje	ct Name			Project No.			Test Plan			
Test No.	Test Description	Test Location	Test Supervisor	Test Specification Reference No.	Test Certificate No.	Test date dd-mm-yyyy	Date passed dd-mm-yyyy	Sign-off	Comments	



			Test Certificate	e No.	S-01					
Project Na	me			Project No.				Tes	t Sched	ule
Description	of system/area:				Plant section:					
Test no.	Test Description		Test date Test start time		Test end time	Repeat test	Date passed dd-mm-yyyy	Test responsibility by	Co	mments
		_			_					



		Test Specification No.								
	Test Specification	on								
Project name		Project No.								
Section of plant										
Equipment under test										
Tag no.										
			Notes							
	Test Objectives									
Test conditions										
	Acceptance criteria	1								
References:		Test specification approva								
Documents:										
		Commissioning Engineer	Site Engineer							
Drawings:										
		Date	Date							



	Commissioning log											
Project Name					Project No.							
Discipline:	= Mechanical / Process itware				Date: dd-mm-yyyy							
Log:												
Action required (Y/N)		If yes, append commissioning snag list	For action by:			Date required dd-mm-yyyy						
Action detail:												
	•											
Reference (List and att	ach to log)											



Proje	ect Name				Project No.				Defects List
Desc	ription of system/area:				Plant section:				
No.	Sub-area	Description	Date raised dd-mm-yyyy	Responsibility	Due completion	Priority	Re-test required	Test No.	Comments
					dd-mm-yyyy.		Y/N		



			Training file No.		
	Training	registe	er		
Project name			Project No.		
Equipment / Plant/ section covered by training					
	Attendan	ce register			
Name	Signature	Name		Signat	ture
Training references m	: naterial		Training completed		
			<u> </u>		
			Commissioning Engi	ineer	Site Engineer
			Date		Date



Test Certification No. S-02 Control System: End-of-day checklist Project name Project No. Section of plant Time check completed: Description Completed Comments or N/A **General for all sites** As-built mark-up and on site Software copies on site Brief on-call staff on current status and any potential issues Migrated tags and status spreadsheet emailed Central Control Room phoned: No alarms showing Check alarm operation DCS or Delta V site specific DCS cold start memory downloaded Download setup data to propagate graphics changes Alarm areas assigned to workstations and remote client session **RTU/ SCADA site specific** Central Control Room phoned: SCADA to RTU communication and alarming is working (test with door open/intruder) Correct equipment status is being shown and trended on CCR **SCADA** For all un-commissioned equipment and active alarms signals an explanation note has been added on the SCADA Current controller software / radio /config copies in QVCS source control and email to cservicedesk@water.co.nz Remarks / instructions: End-of-day sign-off Site Engineer Commissioning Engineer Date Date



Test certification No. C-01 Test specification No. **Pipework** Project name Project No. Line function description Line No. Material type and pressure rating Assessment Checked Comments No. or N/A 1 Installation complete 2 Pipework conforming to P&ID 3 Joints complete, all bolts installed and tightened 4 Mechanical and instrumentation correctly installed 5 Materials comply with specification 6 Pipe and joint restraints suitably installed 7 Pipe coating without defects 8 Correct labels and markers in place Configuration test completed: **Drawing references Commissioning Engineer** Site Engineer Date Date



Test certification No. C-02 Test specification No. Valves / Penstocks / Actuators Project name Project No. **Function description** Manufacturer Tag No. Model No. Manufacturer Serial No Setup No. Assessment Checked Comments or N/A Installation complete as per P&ID and labelled 1 2 Confirm correct valve size, rating and type 3 End of travel switches set correctly 4 Valve rotation on closing ☐ Clockwise ☐ Anti-clockwise 5 Valve rotation indicated and correct 6 Joints complete, all bolts installed and tightened 7 Coating without defects 8 Supports in place 9 Spindle greased 10 Rinsing spindle protection in place 11 Valve fully open and close freely 12 Safe to operate Penstock specific 13 Penstock square without distortion 14 Correct orientation 15 Grouting completed Actuator specific 16 Unused cable entries blanked with correct IP rated plug 17 Earth bonding complete Drawing references Configuration test completed: Attachments: Supplier information **Commissioning Engineer** Site Engineer Date Date



Test certification No. C-03 Test specification No. **General electrical installation** Project No. Project name **Equipment location** From: To: Tag no. Cable or equipment function description Line No. / Tag no. Manufacturer Model no. Manufacturer Serial No No. Assessment Checked Comments or N/A 1 Materials comply with specification: Correct size Correct type Glands installed, correct fit and type Cable armouring earthed at both ends Correct phasing Adequate separation from other cables 2 Equipment certified, calibration in date \square Pre-test OK □ Post –test OK 3 Continuity: Core numbers _ 4 Voltage: Insulation resistance: $(M\Omega)$ Duration: _ sec 5 Fault loop impedance:_ Ω Configuration test completed: Drawing references **Commissioning Engineer** Site Engineer Date Date



			Test certification No.						C-04					
										C-04	•			
			C-1	!l 4.!	El	/ 2.0	Test specif).					
			Cai	ibration	1 – FIO	w / IVIas	ss / Spee	ed .						
Project n	ame						Project No).						
Function description	/ equipmen on	t												
Tag No.							Manufacti	urer						
Model N	0.						Manufacti	urer Serial	No					
Operatin	g range													
Test med	dium													
Operating medium details			Produc	Product										
			Strengt	h										
			Active component											
			Density	Pensity (Mass/volume)										
Test /	Speed / vo	lume	Stroke	Current	Dis	charge	Measur	ed rate	Dos	Dose				
Ref	Setting	Unit [%] (amps)	(amps)	Pressur	e Unit	Value	Unit	Value	Unit	%				
								!						
										<u> </u>				
2. 3.	Multiply the ac The resultant d Dose (mass/tim Actual dose rat	ose in m ne) = Pun	ass/time is p delivery	used to conve X product s	ert to actua strength (ac	ctive compon	-	s taken into c	consideratio	n				
Drawing	references					Configura	ition test co	mpleted:						
Attachm	ents: Pump o	curves	and othe	r reference	es	Commissioning Engineer Site Engineer								

Date

Date



Test certification No. C-05 Test specification No. Level Project name Project No. Equipment Tag No. Manufacturer Model No. Manufacturer Serial No Ref Set point Description **Control function** Check Value Unit Inputs Outputs Ref Description State Check Ref Description State Check Drawing references Configuration test completed: Attachments: Supplier information Site Engineer **Commissioning Engineer** Date Date



Test certification No. C-06 Test specification No. **Instrument installation** Project name Project No. Function description Manufacturer Tag No. Model No. Manufacturer Serial No Setup No. Assessment Checked Comments or N/A Installation complete as per P&ID and labelled 1 2 Confirm correct size, rating and type 3 Coating without defects 4 Supports in place 5 Location safe to view, operate freely and replaceable 6 Cabling installed and earthed 7 All transit packaging is removed 8 Instrument appears undamaged 9 Fastenings are correct and tight 10 All gaskets/O-rings/seals are in place. – Correct IP rating Confirm correct state, orientation of components and 11 direction 12 Correctly identified and labelled 13 Calibration certification current Configuration test completed: Drawing references Attachments: Supplier information **Commissioning Engineer** Site Engineer Date Date



Test certification No. C-07 Test specification No. **Instrument Setup** Project name Project No. Equipment Tag No. Manufacturer Model No. Manufacturer Serial No Calibration requirements Ref Setting Description Ref Setting Description Value Unit Value Unit Inputs Outputs Check Ref Description State Check Ref Description State Drawing references Configuration test completed: Attachments: Supplier information **Commissioning Engineer** Site Engineer Date Date



Test certification No. C-08 Test specification No. **Instrument Loop Calibration** Project No. Project name Equipment Manufacturer Tag No. Model No. Manufacturer Serial No Calibration No. Calibration date Measurement Transmitter Local instrument Panel instrument Transmitter input Notes output reading reading Control Valve position Controller output Transducer Control valve Notes output output positioner **Load devices** Load device / location Type Manufacturer Load Check Inputs Outputs Ref Description State Check Ref Description State Check Drawing references Configuration test completed: Attachments: Supplier information **Commissioning Engineer** Site Engineer Date Date



Test certification No. C-09 Test specification No. **PLC Input / Output test** Project No. Project name Equipment Manufacturer PLC No. Model No. Manufacturer Serial No Module Field devices Action -Tag No. Description 1/0 1/0 I/O to Module View I/O View Module Ch Rack Slot Notes Enabled Module to I/O Graphics Graphic status channel to screen type correct correct OFF/ ON/ 4mA 20mA Attachments: Others (specify) Configuration test completed: Commissioning Engineer Site Engineer Date Date



		Te	Test certification No. C-1										
						Te	est specificat	ion No.					
	PLC Analogue												
Project name						Pi	oject No.						
Equipment									_				
PLC No.						N							
Model No.						Manufacturer Serial No							
			Analogue inp	uts									
Tag No.	Description	Terminals	Range	Rack	Slot	Š	Signal checks	Notes					
						0%	50%	100%					
			Analogue outp	uts			<u> </u>						
Attachments: C	thers (specify)			L		Configurat	ion test com	pleted:					
	Com							missioning Engineer Site Engineer					
						Date		Date					



Test certification No. C-11 Test specification No. **Variable Speed Drive** Project name Project No. **Function description** Manufacturer Tag No. Manufacturer Serial No Model No. Ref Parameter Units Site Notes Factory setting setting Minimum frequency 1 2 Maximum frequency 3 Acceleration time 4 Deceleration time 5 **Current limit** 6 Analogue output minimum 7 Frequency for min. analogue output 8 Frequency for max. analogue output 9 Analogue input minimum 10 Frequency for min. analogue input 11 Frequency for max. analogue input 12 Current supervision limit 13 Frequency supervision limit 14 Reference signal supervision limit 15 High temperature trip setting Outputs Inputs Ref Check Ref Description State Description State Check **Drawing references** Configuration test completed: Attachments: Supplier information Site Engineer **Commissioning Engineer**

Date

Date



Test certification No. F-01 Test specification No. Leakage test Project name Project No. Pipe or structure description Line No. / Tag No. / Equipment Id Material type and maximum pressure rating Ref Assessment Pass / Comments Fail Refer Watercare General Civil and Mechanical Construction standards for leakage testing of pipe and structures, or as otherwise specified by design for the specific structure being tested Layout and description of structure or pipe being tested: Test medium and pressure: Test start time: Test end time: Make-up volume during test: Make-up allowed as per testing standard: Drawing references for structure or pipe under test Function test completed: **Commissioning Engineer** Site Engineer Date Date



						Test certification No.					F-02			
						Tes	st spe	cific	ation	No.				
	Valves / Penstocks / Actuators													
Proje	ct name					Pro	oject	No.						
Funct	tion description													
Tag N	lo.					Ma	Manufacturer							
Mode	el No.					Ма	nufa	cture	er Seri	ial No				
			Setup											
No.	Assessment						ecked N/A	k	Comn	nents				
1	Set to Open on:	□Limit □Torque		_valu	e									
2	Set to Close on:	□Limit □Torque		_valu	e									
3	End of travel sw	itches set correctly												
4	Valve rotation o	n closing							□Clo	ckwise	e □A	nti-cl	ockwi	se
5	Valve/actuator I	ocation indicator, correct i	ndica	tion										
6	Valve operated													
7	Manual /Auto se													
8	Remote manual	operates correctly							Opera	iting ti	me		miı	า.
9	Open / close sig	nals operating												
	Auto remote setup													
			PL	.C			SCADA					МС	C	
			On	ДO	Open	Close	Auto	Manual	Failed	Reset	Avail.	oben	Close	Failed
10	Auto –open													
11	Auto – close													
12	Manual select a	t SCADA - open												
13	Manual select a	t SCADA - close												
14	Manual select a	t MCC - open												
15	Manual select a	t MCC - close												
16	SCADA local rese	et initiated												
17	Remote reset in	itiated												
Draw	ing references					Func	tion 1	test	compl	eted:				
Attachments: Supplier information					Commissioning Engineer				Site Engineer					
Ţ				Date				Date						



Test certification No. F-03 Test specification No. Pump sets / Blowers Project name Project No. Function description Manufacturer Tag No. Manufacturer Serial No Model No. Assessment Checked Comments No. or N/A Mechanical installation complete incl. relief valves etc. 1 Electrical installation complete and certified to operate 3 Alignment completed – couplings and bases 4 Limitations of start-up i.e. not dry run 5 Motor run direction correct □ Clockwise □ Anti-clockwise 6 Emergency stop operates correctly 7 Safety interlocks operate correctly 8 Lubrication systems operate, no leaks 9 Bearing temperature Run duration hrs/min. Full load current of motor within specification Amps Inlet: kPa Pressure during run Discharge: ____kPa Flow rate Theoretical: _____l/m Actual: I/m 10 Vibration measurement within limits 11 Record noise measurement, within limits Inputs Outputs Ref Check Description State Description State Check Drawing references Function test completed: Attachments: Supplier information **Commissioning Engineer** Site Engineer Date Date



Test certification No. F-04 Test specification No. **Chemical dosing control** Project No. Project name Equipment description Tag No. Control loop type Controlled parameter Controlling analysers Control set point Controller settings Test results Attachments: Others (specify) Function test completed: **Commissioning Engineer** Site Engineer Date Date



Test certification No. F-05 Test specification No. **Process control set values** Project No. Project name Section Interface. Units No. Description Equipment Set Tested Comments value value Drawing references Functional test completed: Attachments: Others (specify) **Commissioning Engineer** Site Engineer

Date

Date



Test certification No. F-06 Test specification No. **PLC variables** Project No. Project name Equipment Tag No. Manufacturer Model No. Manufacturer Serial No No. Description Set point **Control function** Tested Comments value Value PLC Units Attachments: Others (specify) Functional test completed: **Commissioning Engineer** Site Engineer Date Date



Test certification No. F-07 Test specification No. **SCADA Analogue** Project No. Project name Section Equipment Manufacturer Model No. Manufacturer Serial No Tag No. Analogue Range Units Reading Graphic Table Trend Instrument Drawing references Functional test completed: Attachments: Others (specify) Commissioning Engineer Site Engineer Date Date



Test certification No. F-08 Test specification No. Interface Project No. Project name Section Tag No. Description Value Units Reading SCADA Instrument PLC Local Remote НМІ CCR Drawing references Functional test completed: Attachments: Others (specify) Commissioning Engineer Site Engineer Date Date